

Parallel shank twist drills


jobber series



CZ Vrtáky s válcovou stopkou | standard

DE Kurze Spiralbohrer mit Zylinderschaft

RU Короткие спиральные свёрла с цилиндр. хвостовиком

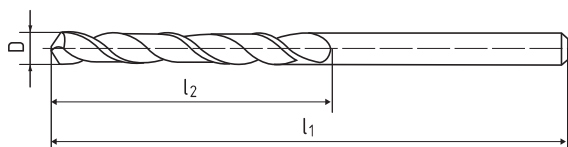

VN10085


VN10018



VN10085



VN10018



D	I1	I2	VN10085	VN10018	D	I1	I2	VN10085	VN10018
1	34	12	.0100		4,8	86	52	.0480	
1,1	36	14	.0110		4,9	86	52	.0490	
1,2	38	16	.0120		5	86	52	.0500	.0500
1,3	38	16	.0130		5,1	86	52	.0510	.0510
1,4	40	18	.0140		5,2	86	52	.0520	.0520
1,5	40	18	.0150		5,3	86	52	.0530	
1,6	43	20	.0160		5,4	93	57	.0540	
1,7	43	20	.0170		5,5	93	57	.0550	.0550
1,8	46	22	.0180		5,6	93	57	.0560	
1,9	46	22	.0190		5,7	93	57	.0570	
2	49	24	.0200		5,8	93	57	.0580	
2,1	49	24	.0210		5,9	93	57	.0590	
2,2	53	27	.0220		6	93	57	.0600	.0600
2,3	53	27	.0230		6,1	101	63	.0610	
2,4	57	30	.0240		6,2	101	63	.0620	
2,5	57	30	.0250		6,3	101	63	.0630	
2,6	57	30	.0260		6,4	101	63	.0640	
2,7	61	33	.0270		6,5	101	63	.0650	.0650
2,8	61	33	.0280		6,6	101	63	.0660	
2,9	61	33	.0290		6,7	101	63	.0670	
3	61	33	.0300	.0300	6,8	109	69	.0680	.0680
3,1	65	36	.0310		6,9	109	69	.0690	
3,2	65	36	.0320	.0320	7	109	69	.0700	.0700
3,3	65	36	.0330	.0330	7,1	109	69	.0710	
3,4	70	39	.0340		7,2	109	69	.0720	
3,5	70	39	.0350	.0350	7,3	109	69	.0730	
3,6	70	39	.0360		7,4	109	69	.0740	
3,7	70	39	.0370		7,5	109	69	.0750	.0750
3,8	75	43	.0380		7,6	117	75	.0760	
3,9	75	43	.0390		7,7	117	75	.0770	
4	75	43	.0400	.0400	7,8	117	75	.0780	
4,1	75	43	.0410		7,9	117	75	.0790	
4,2	75	43	.0420	.0420	8	117	75	.0800	.0800
4,3	80	47	.0430		8,1	117	75	.0810	
4,4	80	47	.0440		8,2	117	75	.0820	
4,5	80	47	.0450	.0450	8,3	117	75	.0830	
4,6	80	47	.0460		8,4	117	75	.0840	
4,7	80	47	.0470		8,5	117	75	.0850	.0850

Parallel shank twist drills


jobber series



CZ Vrtáky s válcovou stopkou | standard

DE Kurze Spiralbohrer mit Zylinderschaft

RU Короткие спиральные свёрла с цилиндр. хвостовиком

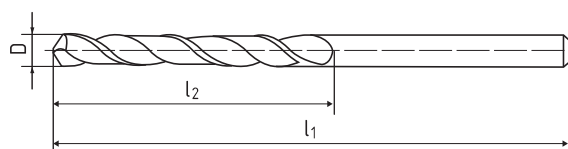

VN10085


VN10018



VN10085



VN10018



D	I1	I2	VN10085	VN10018	D	I1	I2	VN10085	VN10018
8,6	125	81	.0860		12	151	101	.1200	.1200
8,7	125	81	.0870		12,2	151	101	.1220	
8,8	125	81	.0880		12,5	151	101	.1250	.1250
8,9	125	81	.0890		12,8	151	101	.1280	
9	125	81	.0900	.0900	13	151	101	.1300	.1300
9,1	125	81	.0910		13,2	151	101	.1320	
9,2	125	81	.0920		13,5	160	108	.1350	.1350
9,3	125	81	.0930		13,8	160	108	.1380	
9,4	125	81	.0940		14	160	108	.1400	.1400
9,5	125	81	.0950	.0950	14,5	169	114	.1450	.1450
9,6	133	87	.0960		15	169	114	.1500	.1500
9,7	133	87	.0970		15,5	178	120	.1550	.1550
9,8	133	87	.0980		16	178	120	.1600	.1600
9,9	133	87	.0990		16,5	184	125	.1650	.1650
10	133	87	.1000	.1000	17	184	125	.1700	.1700
10,2	133	87	.1020		17,5	191	130	.1750	.1750
10,5	133	87	.1050	.1050	18	191	130	.1800	.1800
10,8	142	94	.1080		18,5	198	135	.1850	.1850
11	142	94	.1100	.1100	19	198	135	.1900	.1900
11,2	142	94	.1120		19,5	205	140	.1950	.1950
11,5	142	94	.1150	.1150	20	205	140	.2000	.2000
11,8	142	94	.1180						

VN10085	P.1	P.2	P.3	P.4	P.5	P.6	K.1	K.2	M.1	M.2	M.3	N.4	S.1	H.2
VN10018	P.1	P.2	P.3	P.4	P.5	P.6	K.1	K.2	M.1	M.2	M.3	N.4	S.1	H.2

HSS/SC